

June 14, 2006

Gentlemen:

DCP360i "K" ink ribbon firmware version up information

In order to introduce the updated firmware for K-only ink ribbon, we would like to announce the following:

1. The updated version

- Firmware : B022.prf
- Configuration Data : CX120_96.cfg
- Table Data : CX120_2C.tbl (no change)

2. The other modification

Roller cleaning movement

We added about 10 seconds waiting time just after cleaning start.

3. Shipment

June, 2006

4. Download and Initializing Procedure

No.	Procedure	Printer Conditions	Status Monitor
1	Refer to the DCP360i Instructions, down load the firmware.	-	-
2	Close the Status Monitor and power off the printer.	-	-
3	Power on the printer without ink ribbon cassette.	After the printer intializing, Error Buzzer blows, READY LED gose out and ERROR, INK LED blinks.	-
4	Boot the Status Monitor.	-	Error(01043681: Ink mark is not found. Please.....) on Printer Status. There is no display on Ink Lot Number.
5	Press the RESET and CLEAN switches simultaneously, and keep more than one second.	Boot the initialization setting mode, READY LED blinks, ERROR and CARD LED gose on, INK LED gose out.	Offline Mode on Prnter Status.
6	-	When the initialization setting is completed, buzzer blows and LED gose back to No.2.	Printer Status display goes back to No.3. The initilized number on Lot Number. (See the following picture)
7	Confirm the initialize setting data is 90 or more. If it is less than 90, adjust the printer.	-	-
8	Close the Status Monitor and power off the printer.	-	-

* If the initialization is not completed, the printer might malfunction.

